

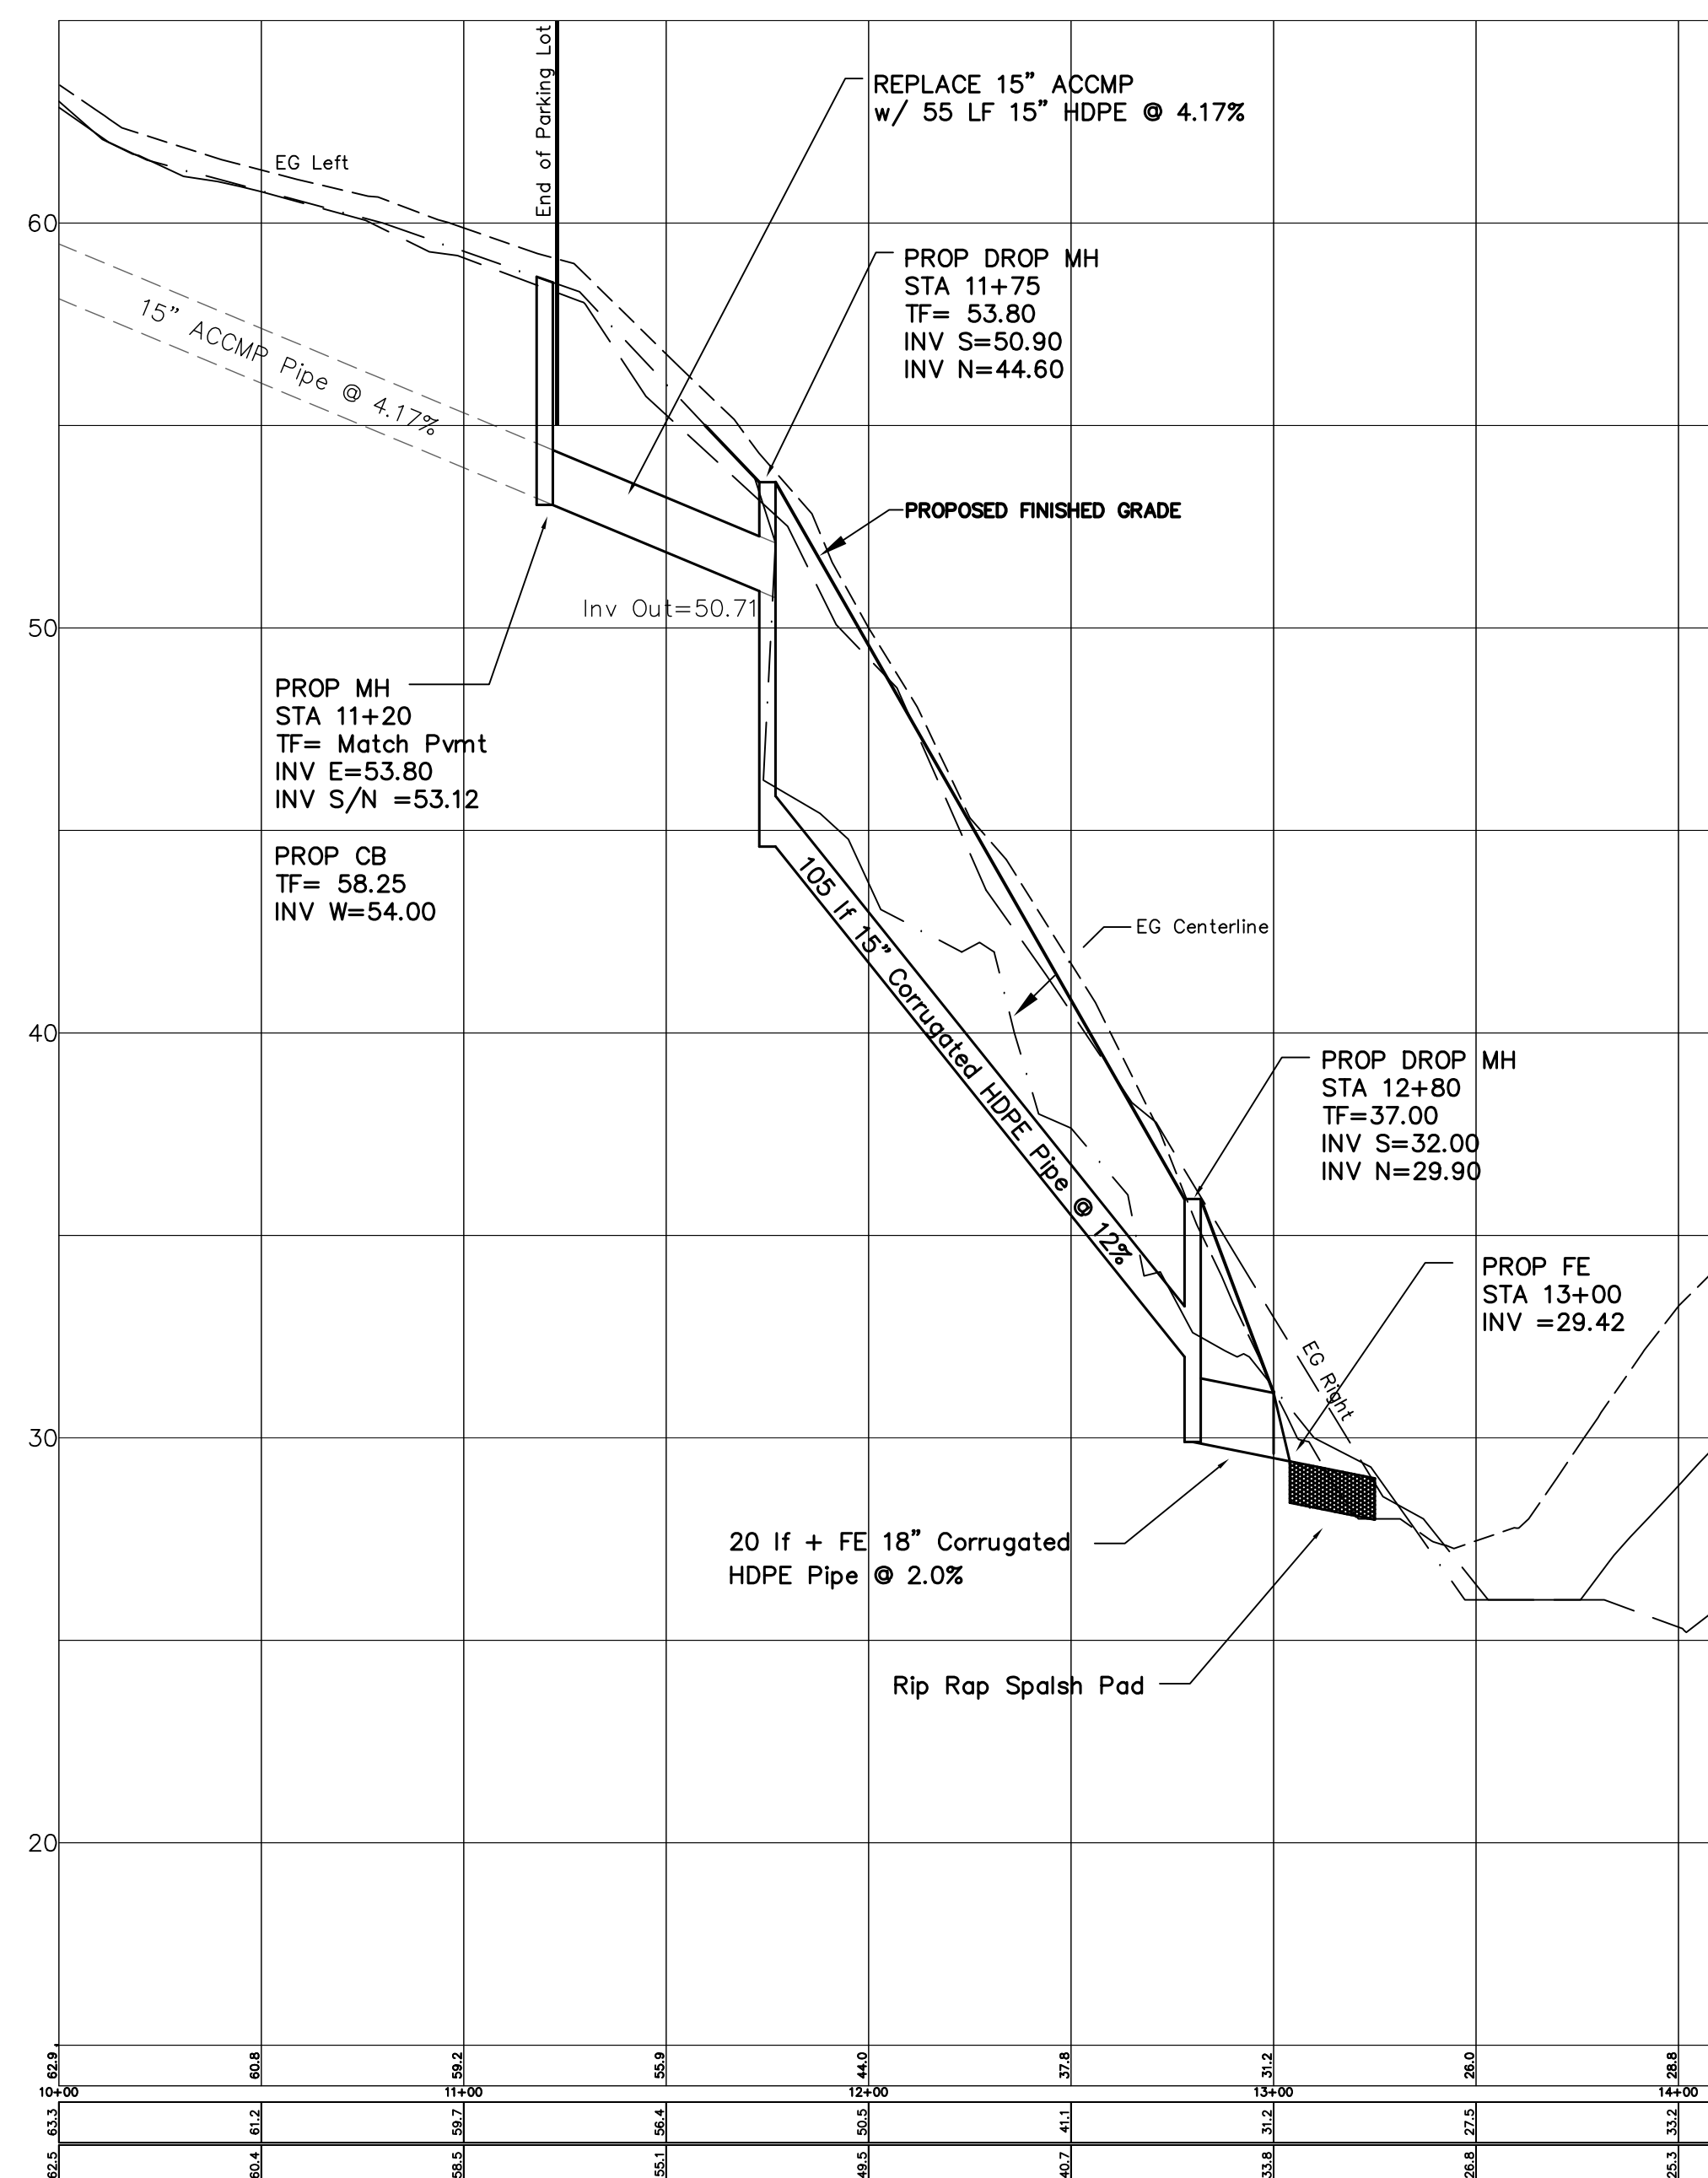
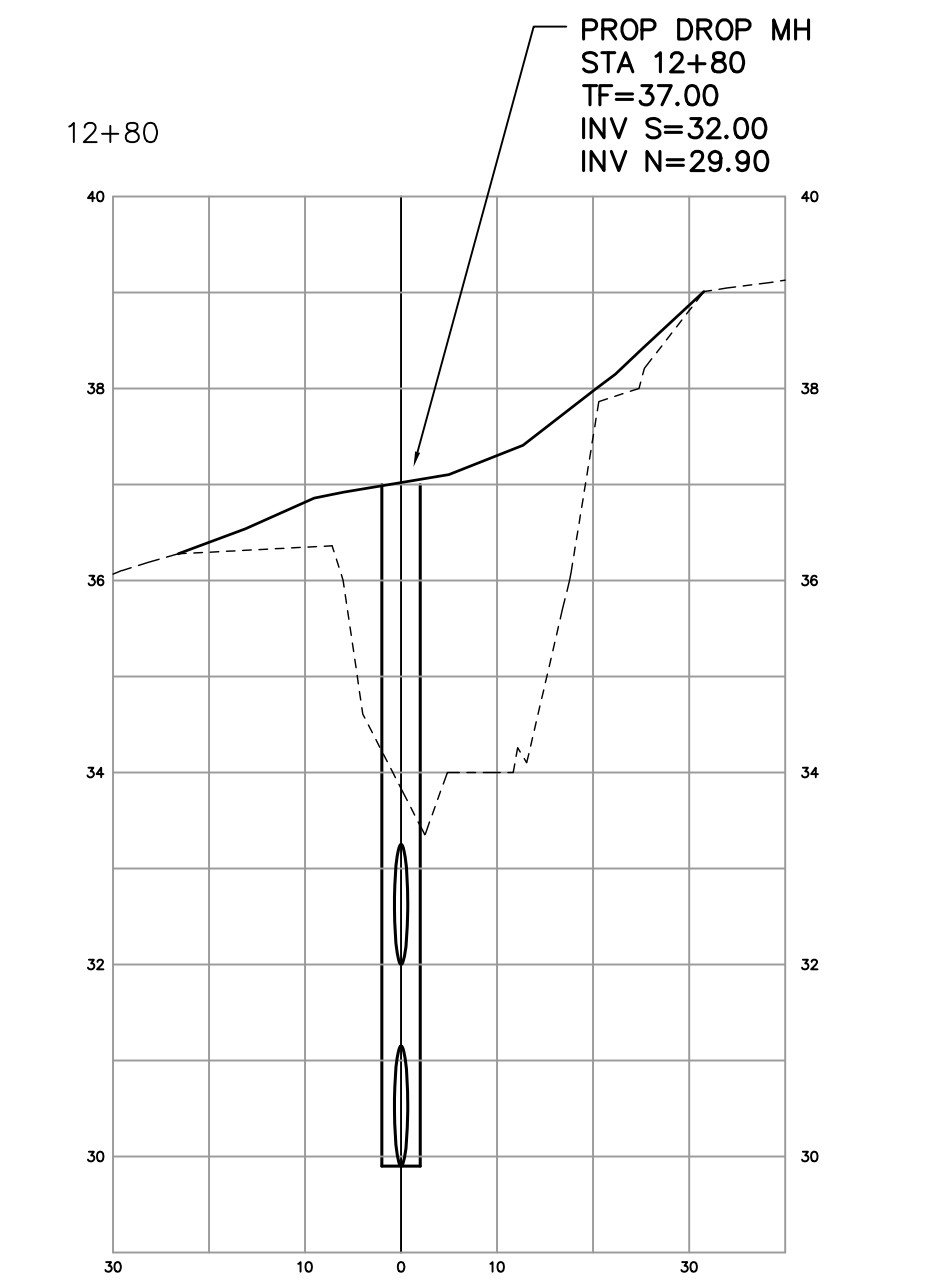
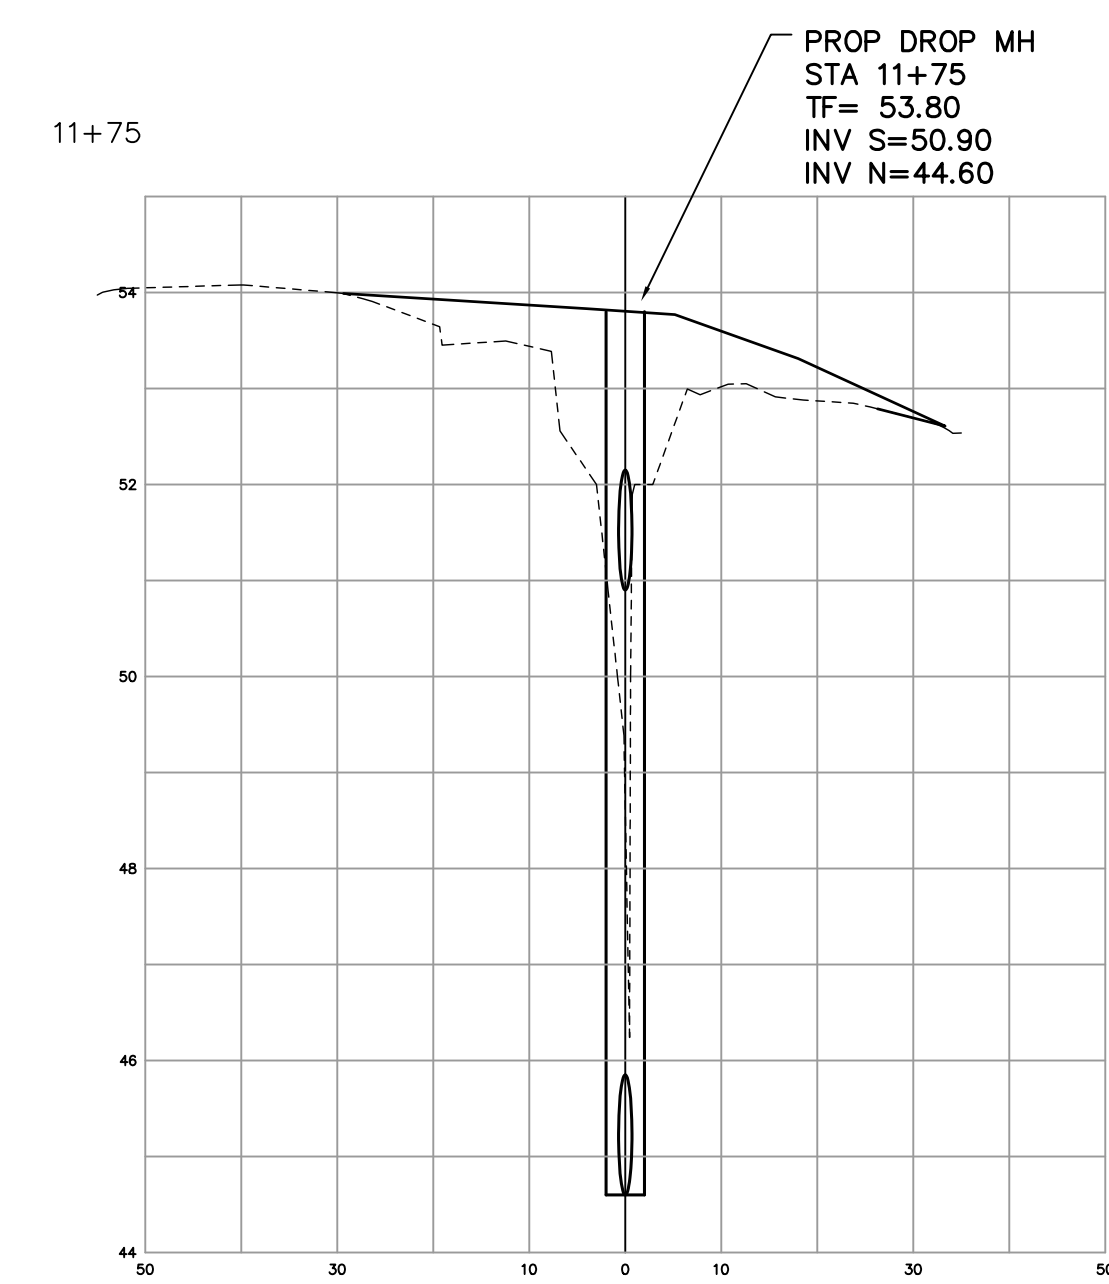


EXITING PROFILE ALONG DITCH  
1"=40' H  
1"=4' V

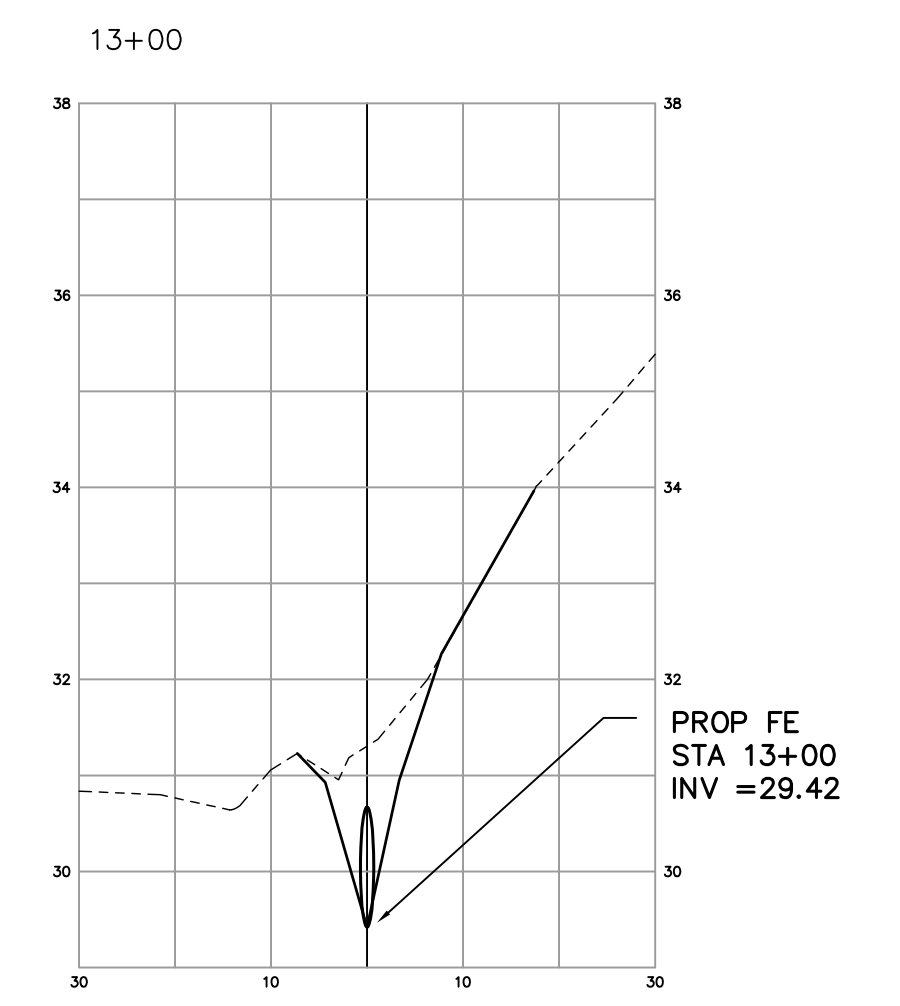

EXITING/PROPOSED PROFILE ALONG PROPOSED PIPE  
1"=40' H  
1"=4' V

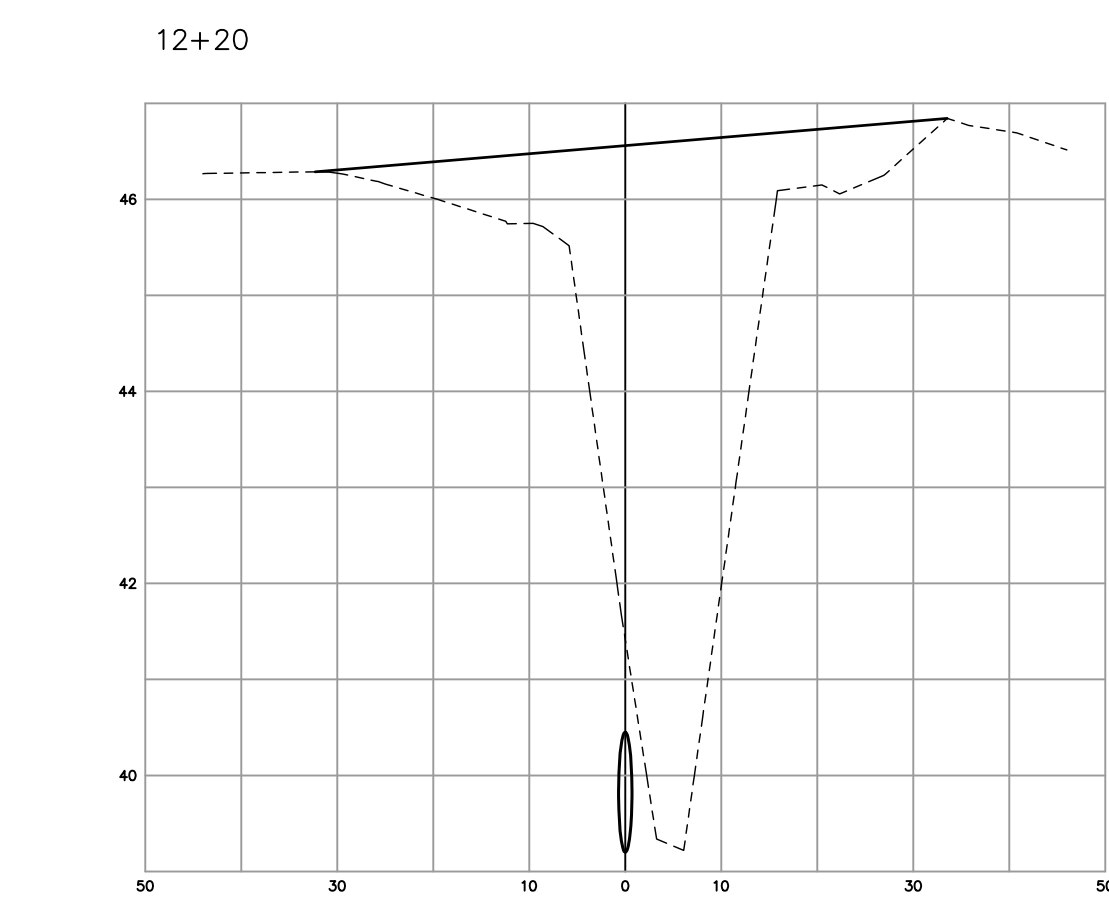

CROSS SECTIONS  
1"=20' H  
1"=2' V



Exist Outlet  
4/13/15  
Photo 1



Sloughing at Outlet  
4/13/15  
Photo 2



Sloughing at Outlet  
5/11/15  
Photo 3



Erosion at Outlet  
4/13/15  
Photo 4



Erosion Creating Ditch  
4/13/15  
Photo 5




Erosion Creating Ditch  
4/15/15  
Photo 6



Erosion Creating Ditch  
9/24/13  
Photo 7



Water Impounded by  
9/24/13  
Photo 8


**TOWN OF ROCKY HILL**  
**ENGINEERING DEPARTMENT**  
 761 OLD MAIN STREET, ROCKY HILL, CT 06067  
 PHONE (860)258-2766 FAX (860) 258-2703  
 James C. Solimi P.E., L.S., Director of Community Development

**PROFILE & CROSS SECTIONS**

**EROSION AT BUCKLEY PARK**  
 MICHELE DRIVE  
 ROCKY HILL, CONNECTICUT

Date: 5/25/15 | Scale: As Shown | Drawn By: SDS | Sheet 3 of 4